

12095 SATURN VUE, ALL INC. REDLINE, CHEVY CAPTIVA

2/2/2009


GROSS LOAD CAPACITY WHEN USED AS A WEIGHT CARRYING HITCH: 3,500 LBS. TRAILER WEIGHT & 300 LBS. TONGUE WEIGHT.

DO NOT EXCEED VEHICLE MANUFACTURER'S RECOMMENDED TOWING CAPACITY.

Parts List			
ITEM	QTY	PART NUMBER	DESCRIPTION
1	6	M12-1.75 x 35mm	HEX BOLT
2	6	1/2"	CONICAL TOOTHED WASHER
15	1	S0107U	3500/300 RATING, NEWART,
		RUBBER ISOLATOR	3.5"x1"
16		REMOVAL DIAGRAM	
		S0725U	3500/350 LB, 3 1/8" RISE,
		NEWART	

Using a 5/8" open end wrench, slide the wrench up to the rubber isolator, cradling the hanger rod as shown. Next place the flat edge of a pry bar between the wrench and the hanger stop or hanger rod. Then simply rotate the pry bar toward the wrench to remove the rubber isolator.

Note: Using a spray lubricant or soapy water on the hanger rod and the rubber isolator helps removal.

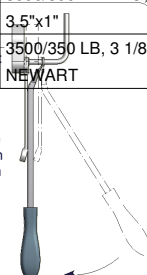

PASSENGER SIDE FRAME RAIL

DRIVER SIDE FRAME RAIL

EXISTING WELDNUTS
(3 PER SIDE)

DESIGNED FOR USE WITH
BALL MOUNT # D-20 / 45520

HITCH WEIGHT: 28 LBS.
INSTALL TIME: 20 MINUTES
INSTALL NOTES:
- LOWER EXHAUST
- NO DRILLING REQUIRED

INSTALLATION STEPS

- 1) Lower the exhaust by removing the (4) rear exhaust hangers. (See Rubber Isolator Removal Diagram.)
- 2) Raise the hitch into position between the frame rails, aligning the holes in the hitch with the weldnuts within the frame rails.
- 3) Install supplied 12mm hex bolts and conical toothed washers as shown.
- 4) Torque all 12mm fasteners to 60 lb-ft.

PERIODICALLY CHECK THIS RECEIVER HITCH TO ENSURE THAT ALL FASTENERS ARE TIGHT AND THAT ALL STRUCTURAL COMPONENTS ARE SOUND.

Curt Manufacturing Inc., warrants this product to be free of defects in material and/or workmanship at the time of retail purchase by the original purchaser. If the product is found to be defective, Curt Manufacturing Inc., may repair or replace the product, at their option, when the product is returned, prepaid, with proof of purchase. Alteration to, misuse of, or improper installation of this product voids the warranty. Curt Manufacturing Inc.'s liability is limited to repair or replacement of products found to be defective, and specifically excludes liability for incidental or consequential loss or damage.